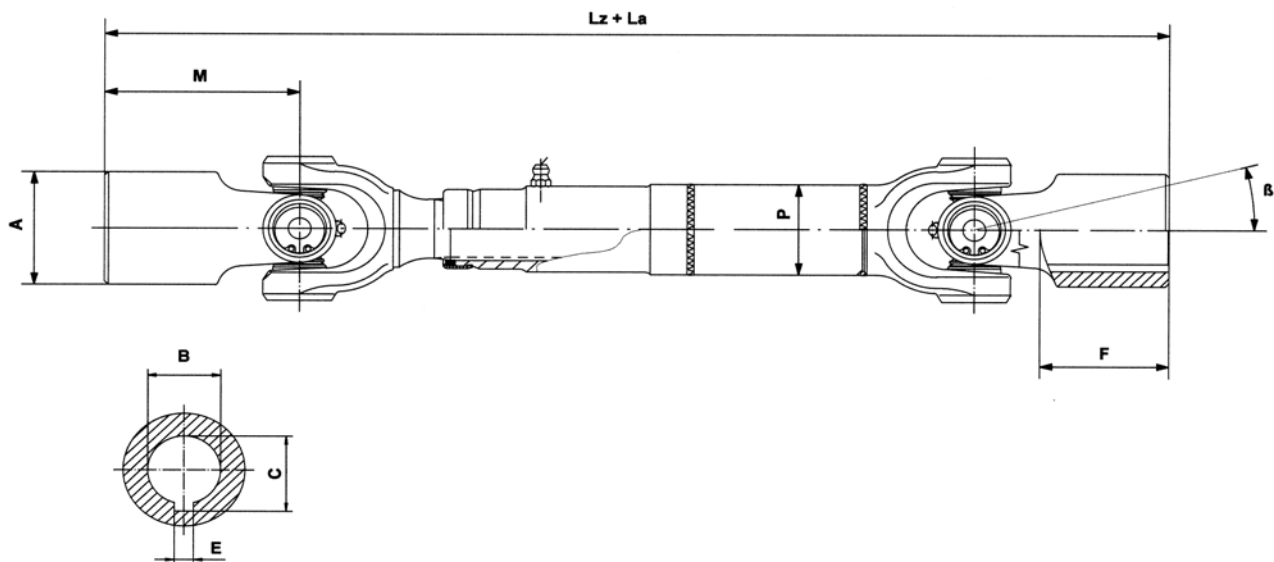


TRASMISSIONI CARDANICHE A MOZZO


Tipo	Md	A	M	F	B ^{H7}	C	E	Lz	La	β
	Nm	mm	mm	mm	mm	mm	mm	mm	mm	°
14MC	100	32	45	22	18	20,8	6	260	45	35
17MC	190	36	50	25	20	22,8	6	295	40	30
18MC	320	42	60	34	25	28,3	8	345	60	30
22MC	650	50	80	46	30	33,3	8	450	70	30
27MC	800	57	80	50	35	38,3	10	465	80	20
30MC	1450	62	90	58	40	43,3	12	550	100	20

A richiesta: esecuzioni corte, extra-corte, fisse
 Lz , La e forature a disegno